


丈六ため池 測定結果

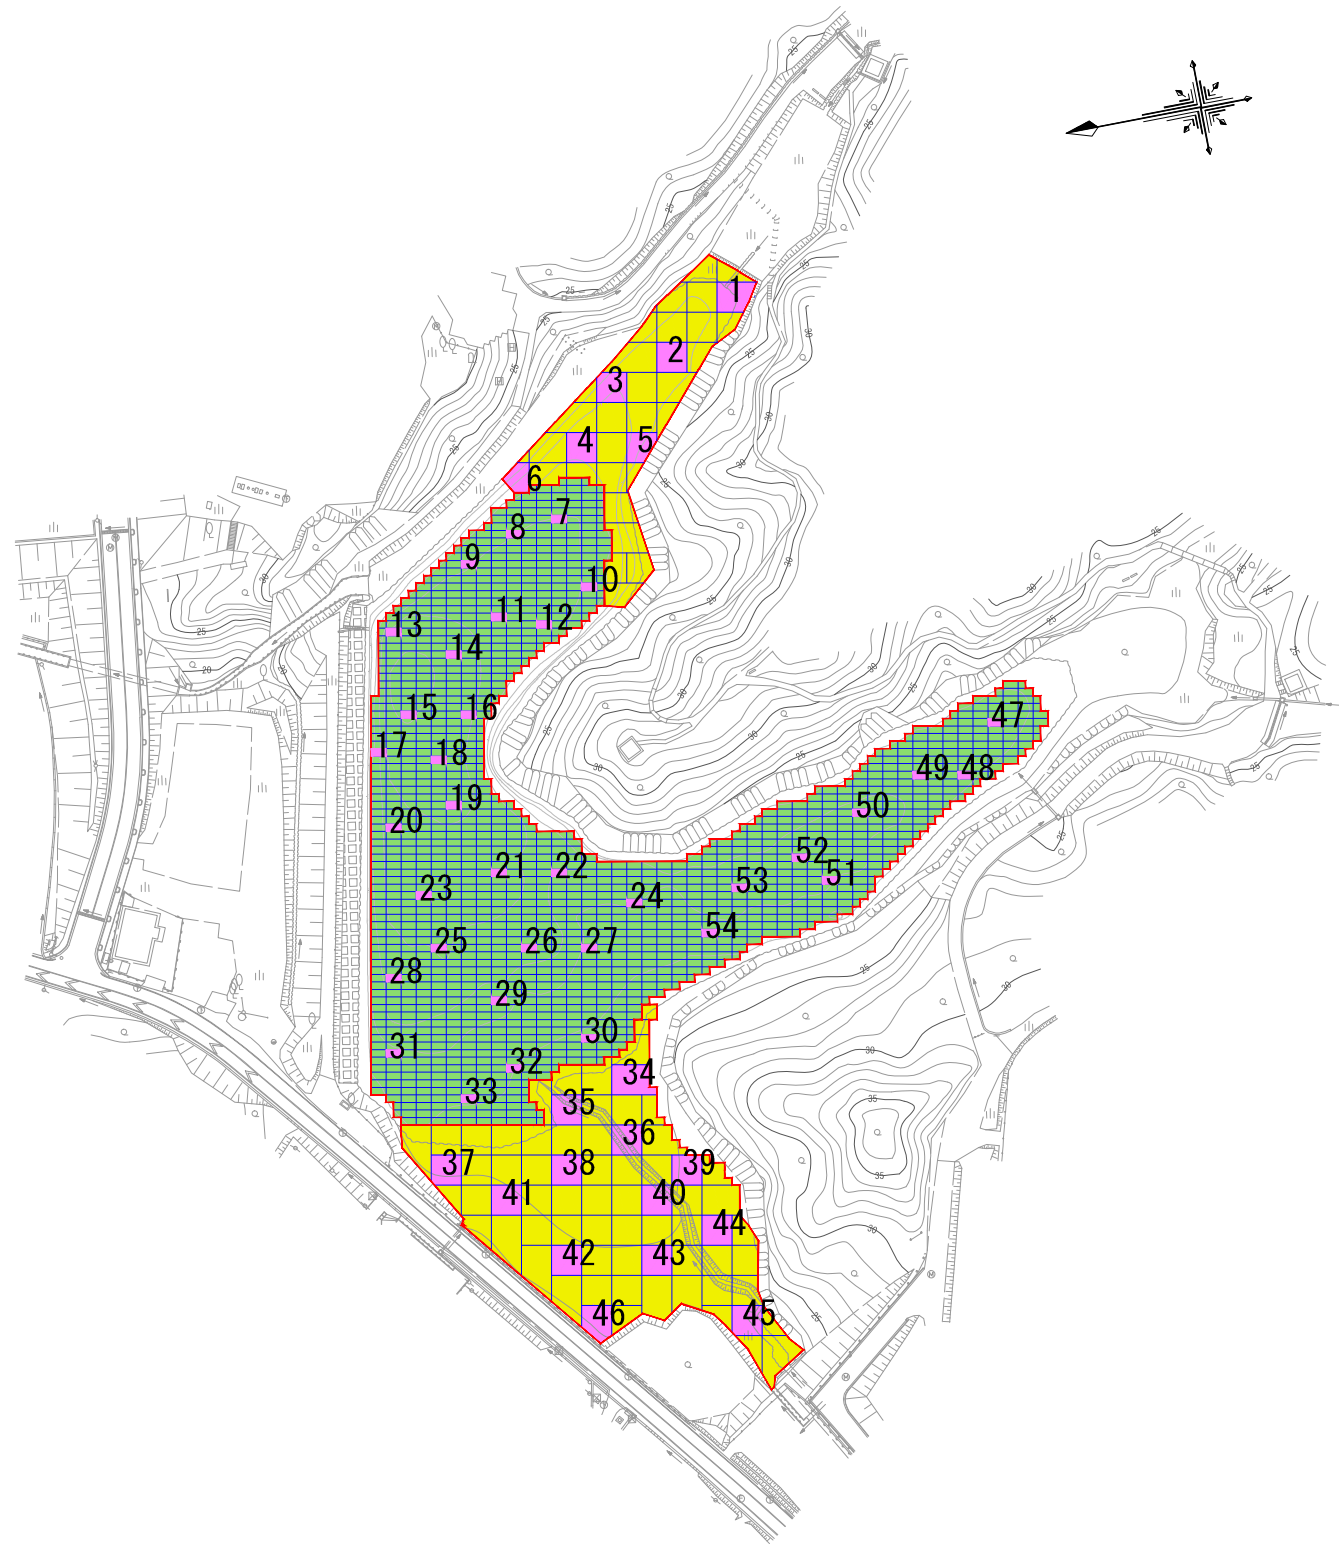

凡 例	
	対 策 範 囲
	掘 削 施 工
	浚 渫 施 工
	品 質 管 理 点

池名	品質管理地点	対策前	対策後	低減率
		(¹³⁴ Cs, ¹³⁷ Cs合算) Bq/kg(dry)	(¹³⁴ Cs, ¹³⁷ Cs合算) Bq/kg(dry)	
丈六ため池	1	8,400	530以下	93.7%
	2	23,000	270以下	98.8%
	3	22,000	270以下	98.8%
	4	9,400	2,700	71.3%
	5	21,000	検出下限以下	99.8%
	6	20,000	79以下	99.6%
	7	21,000	3,900	81.4%
	8	18,000	3,600	80.0%
	9	20,000	4,900	75.5%
	10	19,000	2,100	88.9%
	11	29,000	5,300	81.7%
	12	26,000	1,500	94.2%
	13	38,000	2,100	94.5%
	14	29,000	730以下	97.5%
	15	36,000	820以下	97.7%
	16	21,000	2,700	87.1%
	17	170,000	800以下	99.5%
	18	26,000	130以下	99.5%
	19	26,000	7,300	71.9%
	20	59,000	350以下	99.4%
	21	26,000	210以下	99.2%
	22	14,000	2,400	82.9%
	23	33,000	150以下	99.5%
	24	22,000	240以下	98.9%
	25	29,000	1,400	95.2%
	26	21,000	5,800	72.4%
	27	10,000	4,500	55.0%
	28	29,000	780以下	97.3%
	29	32,000	580以下	98.2%
	30	13,000	170以下	98.7%
	31	20,000	検出下限以下	99.8%
	32	19,000	2,700	85.8%
	33	20,000	190以下	99.1%
	34	20,000	54以下	99.7%
	35	13,000	340以下	97.4%
	36	18,000	検出下限以下	99.8%
	37	25,000	260以下	99.0%
	38	8,600	1,200	86.0%
	39	30,000	検出下限以下	99.9%
	40	24,000	89以下	99.6%
	41	24,000	53以下	99.8%
	42	11,000	50以下	99.5%
	43	17,000	250以下	98.5%
	44	14,000	検出下限以下	99.7%
	45	10,000	検出下限以下	99.6%
	46	10,000	49以下	99.5%
	47	25,000	150以下	99.4%
	48	16,000	1,000	93.8%
	49	15,000	130以下	99.1%
	50	16,000	検出下限以下	99.8%
	51	18,000	7,300	59.4%
	52	18,000	1,900	89.4%
	53	17,000	3,700	78.2%
	54	21,000	6,700	68.1%
	平均	24,081	1,532	91.8%

※検出下限値 = 40Bq/kg

