


川添ため池 測定結果

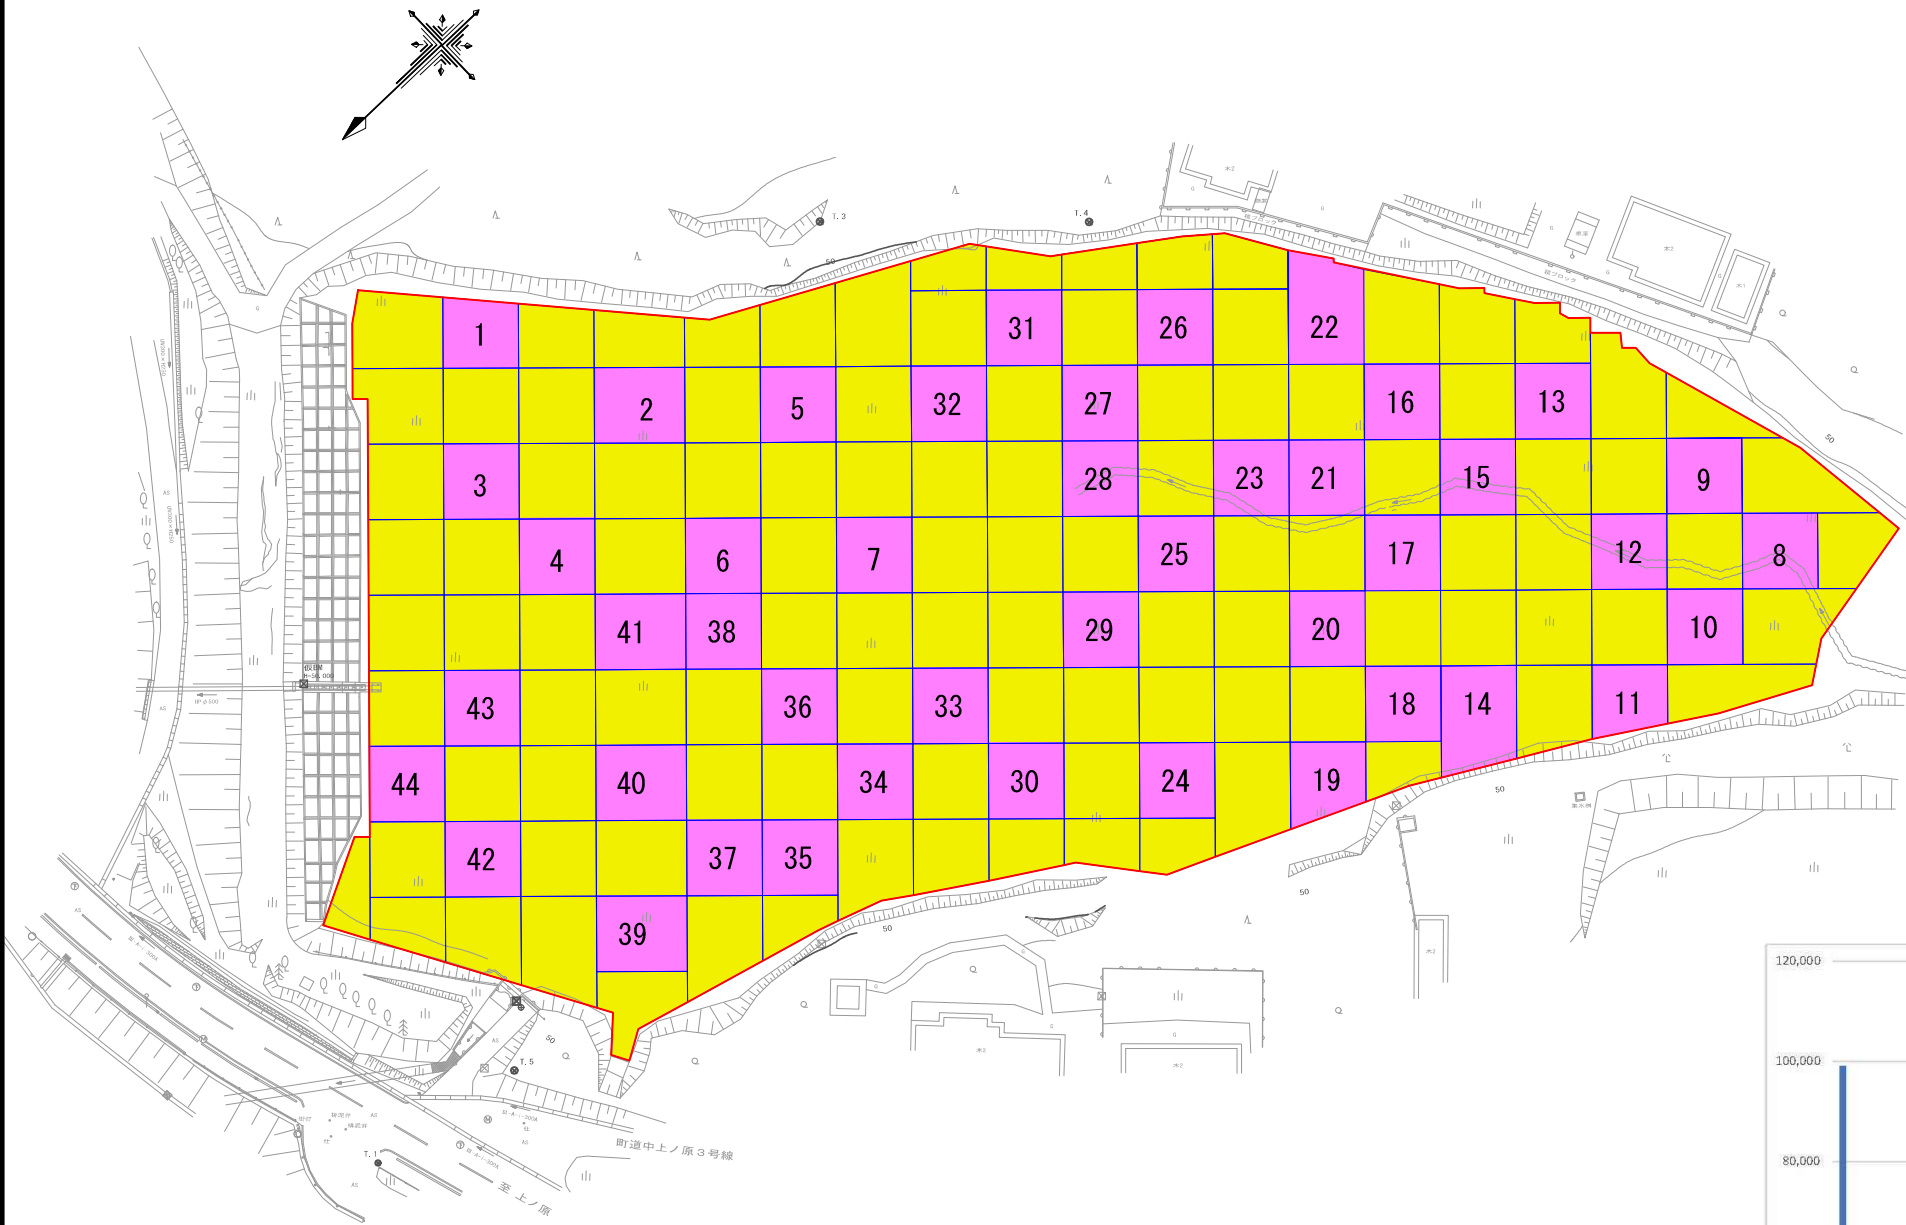

| 凡 例 | |
|---|-------|
| | 対策範囲 |
| | 掘削施工 |
| | 品質管理点 |

| 池名 | 品質管理地点 | 対策前 | 対策後 | 低減率 |
|-------|--------|---|---|-------|
| | | (¹³⁴ Cs, ¹³⁷ Cs合算) Bq/kg(dry) | (¹³⁴ Cs, ¹³⁷ Cs合算) Bq/kg(dry) | |
| 川添ため池 | 1 | 99,000 | 2,700 | 97.3% |
| | 2 | 29,000 | 140以下 | 99.5% |
| | 3 | 28,000 | 1,000 | 96.4% |
| | 4 | 32,000 | 420以下 | 98.7% |
| | 5 | 24,000 | 1,200 | 95.0% |
| | 6 | 23,000 | 5,000 | 78.3% |
| | 7 | 19,000 | 500以下 | 97.4% |
| | 8 | 29,000 | 260以下 | 99.1% |
| | 9 | 14,000 | 160以下 | 98.9% |
| | 10 | 51,000 | 360以下 | 99.3% |
| | 11 | 33,000 | 140以下 | 99.6% |
| | 12 | 58,000 | 1,700 | 97.1% |
| | 13 | 33,000 | 250以下 | 99.2% |
| | 14 | 30,000 | 検出下限以下 | 99.9% |
| | 15 | 35,000 | 180以下 | 99.5% |
| | 16 | 9,100 | 380以下 | 95.8% |
| | 17 | 35,000 | 270以下 | 99.2% |
| | 18 | 20,000 | 検出下限以下 | 99.8% |
| | 19 | 17,000 | 66以下 | 99.6% |
| | 20 | 17,000 | 1,200 | 92.9% |
| | 21 | 28,000 | 70以下 | 99.8% |
| | 22 | 17,000 | 100以下 | 99.4% |
| | 23 | 13,000 | 3,600 | 72.3% |
| | 24 | 27,000 | 440以下 | 98.4% |
| | 25 | 18,000 | 検出下限以下 | 99.8% |
| | 26 | 24,000 | 検出下限以下 | 99.8% |
| | 27 | 20,000 | 750 | 96.3% |
| | 28 | 17,000 | 380以下 | 97.8% |
| | 29 | 17,000 | 370以下 | 97.8% |
| | 30 | 36,000 | 220以下 | 99.4% |
| | 31 | 16,000 | 検出下限以下 | 99.8% |
| | 32 | 15,000 | 検出下限以下 | 99.7% |
| | 33 | 9,100 | 380以下 | 95.8% |
| | 34 | 10,000 | 190以下 | 98.1% |
| | 35 | 16,000 | 1,100 | 93.1% |
| | 36 | 26,000 | 610 | 97.7% |
| | 37 | 25,000 | 960 | 96.2% |
| | 38 | 23,000 | 100以下 | 99.6% |
| | 39 | 15,000 | 320以下 | 97.9% |
| | 40 | 25,000 | 3,900 | 84.4% |
| | 41 | 15,000 | 230以下 | 98.5% |
| | 42 | 35,000 | 5,100 | 85.4% |
| | 43 | 34,000 | 7,000 | 79.4% |
| | 44 | 47,000 | 4,300 | 90.9% |
| | 平均 | 26,436 | 1,052 | 95.9% |

※検出下限値 = 40Bq/kg

