

仮置場等管理月次報告

【浪江町】

平成26年11月5日

仮置場名：酒田

仮置場所在地：浪江町大字酒田字南2丁目5 外


1. 点検結果

	10/3	10/7	10/10	10/14	10/16	10/22	10/29	適用
通常巡視	○	-	○	-	○	○	○	・A7内部温度と外気温の差が30℃以上
緊急点検	-	○	-	○	-	-	-	・10/7,10/14降水量が60mm/24hを超過したため点検実施

備考 全ての点検項目に異常がない場合：「○」、一つでも要注意項目がある場合：「△」、早期に改善を要する場合：「×」

2. 空間線量率 単位：μSv/h


	10/3	10/10	10/16	10/22	10/29
①	0.34	0.35	0.36	0.36	0.36
②	0.35	0.35	0.34	0.34	0.34
③	0.79	0.80	0.79	0.79	0.79
④	0.60	0.59	0.58	0.58	0.58
⑤内	0.63	0.61	0.59	0.60	0.58
⑥外	0.63	0.62	0.60	0.58	0.58

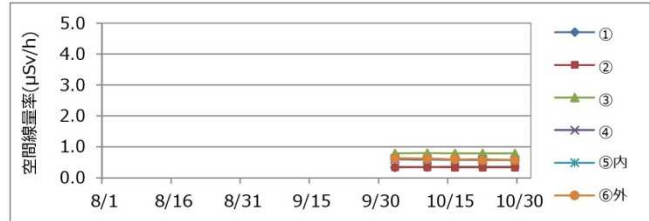


3. 除去物内部温度 単位：℃

	10/3	10/10	10/16	10/22	10/29
A1	① 44.9	44.3	42.4	41.3	40.9
	② 48.2	48.1	44.6	42.8	40.6
	③ 43.8	41.6	39.9	38.5	37.5
	④ 39.7	39.1	36.9	35.1	33.5
A2	① 51.8	51.1	50.8	49.9	49.8
	② 34.4	35.1	34.8	34.7	33.9
A3	① 53.0	52.1	51.2	50.3	49.1
	② 55.5	55.5	54.3	53.8	53.7
	③ 48.6	48.3	47.3	46.1	45.6
	④ 53.5	53.1	51.3	51.7	52.2
A4	① 49.8	48.9	48.3	47.7	48.2
	② 46.9	46.3	45.6	45.0	45.5
	③ 51.1	50.3	49.3	48.3	48.0
	④ 46.9	44.9	44.3	44.1	44.4
	⑤ 46.1	44.2	44.2	43.0	43.4
A5	① 46.4	44.5	41.9	40.0	36.6
	② 50.2	49.6	48.2	47.4	47.3
	③ 44.6	43.6	42.2	41.5	41.3
	④ 42.2	40.8	41.1	40.4	40.6
	⑤ 45.4	43.0	42.2	40.5	40.6
A7	① 44.2	43.7	43.0	42.1	41.6
	② 49.1	48.4	46.1	44.5	44.1
	③ 59.2	58.0	57.7	56.4	57.7
	④ 47.8	44.4	42.6	42.8	42.4
	⑤ 38.7	36.0	31.8	26.5	24.5
外気 (A3)	22.7	25.2	16.7	12.6	16.9


〔A1,A2,A3,外気〕

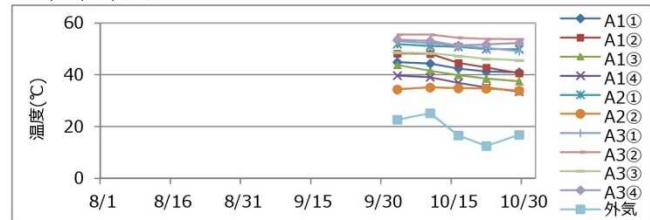

〔A4,A5〕

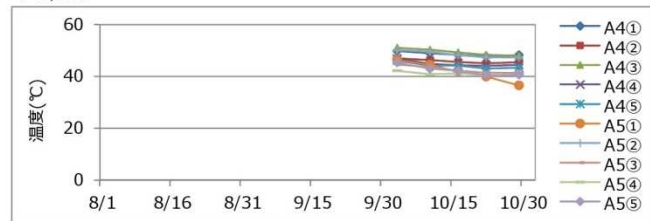

〔A7〕

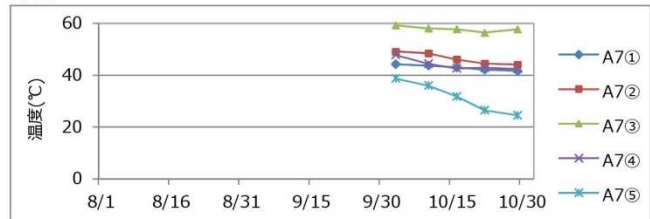

4. 地下水(塩ビ孔口からの水位) 単位:m

	10/3	10/10	10/16	10/22	10/29
①	2.36	1.95	1.78	2.04	2.15
②	1.38	0.98	0.70	0.88	1.05

5. 浸出水

〔水深〕 単位：cm

	孔底	10/3	10/10	10/16	10/22	10/24	10/29
A1	208	46	51	56	58	—	12
A2	204	53	154	164	102	153	164
A3	209	21	49	82	91	—	11
A4	213	28	165	168	168	168	17
A5-1	209	54	117	128	36	—	39
A5-2	212	8	12	14	14	—	12
A6	205	28	83	158	158	160	13
A7-1	212	32	186	186	161	163	170
A7-2	207	12	175	182	107	116	150
A8	208	24	74	147	152	159	22
A9-1	207	12	58	77	97	—	12
A9-2	207	13	73	150	154	—	18
A10	207	32	141	157	157	159	19
A11-1	207	20	55	82	113	—	18
A11-2	207	42	48	49	52	—	19
B1-1	210	37	135	137	85	120	135
B1-2	205	18	31	36	36	—	13
B2-1	206	55	144	145	129	138	156
B2-2	211	15	135	137	44	—	129
B3-1	208	56	144	153	125	—	143
B3-2	200	33	100	162	22	—	24
B4-1	209	74	157	158	107	—	154
B4-2	212	8	20	22	132	—	20
B5-1	213	33	99	157	159	—	26
B5-2	207	53	90	154	157	—	25
B6-1	210	65	150	155	142	—	150
B6-2	209	33	109	158	8	—	12
B7-1	210	34	150	151	87	—	150
B7-2	205	34	34	93	95	—	14

〔汲み出し量〕 単位：m³

	10/3	10/10	10/16	10/22	10/24	10/29
A1	—	—	—	0.7	—	—
A2	—	—	2.1	—	—	2.1
A3	—	—	—	1.2	—	—
A4	—	—	—	—	2.2	—
A5-1	—	—	1.7	—	—	—
A5-2	—	—	—	0.4	—	—
A6	—	—	—	—	2.1	—
A7-1	—	—	2.1	—	—	2.1
A7-2	—	—	2.1	—	—	2.0
A8	—	—	—	—	2.1	—
A9-1	—	—	—	1.2	—	—
A9-2	—	—	—	2.0	—	—
A10	—	—	—	—	2.1	—
A11-1	—	—	—	1.5	—	—
A11-2	—	—	—	0.8	—	—
B1-1	—	—	1.8	—	—	1.8
B1-2	—	—	—	0.5	—	—
B2-1	—	—	1.9	—	—	2.0
B2-2	—	—	1.8	—	—	1.7
B3-1	—	—	2.0	—	—	1.9
B3-2	—	—	2.1	—	—	—
B4-1	—	—	2.0	—	—	2.0
B4-2	—	—	—	1.7	—	—
B5-1	—	—	—	2.1	—	—
B5-2	—	—	—	2.1	—	—
B6-1	—	—	2.0	—	—	2.0
B6-2	—	—	2.0	—	—	—
B7-1	—	—	2.0	—	—	2.0
B7-2	—	—	—	1.2	—	—

